

**Serie ZETA®  
NO HF**

Serie **Z** PLASMA CUTTING  
CONSUMABLES LL



CE EN60974-7



CODE	↔	⏏
------	---	---

PAZ006D-000-FA3	6 m	19.7'	
PAZ008D-000-FA3	7,6 m	25'	
PAZ015D-000-FA3	15,2 m	50'	

PAZ006D-004-FA3	6 m	19.7'	
PAZ008D-004-FA3	7,6 m	25'	
PAZ015D-004-FA3	15,2 m	50'	


PAZ006D-100-FA3	6 m	19.7'	
PAZ008D-100-FA3	7,6 m	25'	
PAZ015D-100-FA3	15,2 m	50'	

PAZ006D-200-FA3	6 m	19.7'	
PAZ008D-200-FA3	7,6 m	50'	
PAZ015D-200-FA3	15,2 m	50'	

PAZ006D-304-FA3	6 m	19.7'	
PAZ008D-304-FA3	7,6 m	25'	
PAZ015D-304-FA3	15,2 m	50'	

TECHNICAL DATA					
----------------	--	--	--	--	--

NO HF	40 A	60 A	80 A	110 A	130 A
	0,4 kg 0,88 lb	0,4 kg 0,88 lb	0,4 kg 0,88 lb	0,4 kg 0,88 lb	0,4 kg 0,88 lb
<b>V PEAK</b>	500	500	500	500	500
	5 bar	5 bar	5 bar	5 bar	5 bar
	110 l/m	120 l/min	140 l/min	155 l/m	180 l/m
<b>X 60%</b>	40A	60A	80A	110A	130A
<b>X 100%</b>	30A	45A	65A	85A	105A
	15 mm 3/5"	25 mm 1"	32 mm 1 1/4"	40 mm 1 3/5"	45 mm 1 3/4"

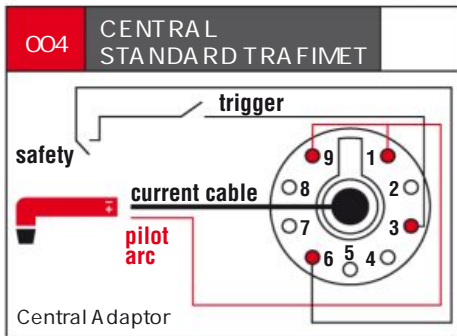

**SPARE PARTS  
NOT INCLUDED**

	CODE		Ø	↔	STARTER KIT					PCS X	X	
					PT1042	PT1062	PT1082	PT1112	PT1132			
					40 A	60 A	80 A	110 A	130 A			
1	CV0373P					•	•				1	2
1	CV0374P							•			1	2
1	CV0367P							•	•		1	2
2	PC0360P					•	•	•	•	•	1	2
3	PD0365P09					•					5	2
3	PD0365P11						•				5	2
3	PD0365P12							•			5	2
3	PD0364P15							•			5	2
3	PD0363P17								•		5	2
4	PE0361P					•	•	•	•	•	1	2
5	PR0360P					•	•	•			5	2
5	PR0361P							•	•		5	2
6	FH1602P					•	•	•	•	•	1	2

	CODE			
7	EA1920			
7	PF0360			
8	BX0910			
8	PT0361			
8	PT0362			
9	TP0360			1
10	PH0908-06		6m - 1/4 G	1
10	PH0908-08		7,6m - 1/4 G	1
10	PH0908-15		15m - 1/4 G	1
11	BW0147		cable support	1
11	FY0043		Central Adaptor	1
12	FY0090		TRAFIMECTOR®	1

	CODE		GOUGING	40 A	60 A	80 A	110 A	130 A	PCS X	X
1	CV0370P			•	•	•			1	2
1	CV0371P						•		1	2
1	CV0372P							•	1	2
3	PD0370P16			•	•				5	2
3	PD0370P18					•			5	2
3	PD0370P20						•		5	2
3	PD0370P22							•	5	2